

Work Order ID 159595

Thursday, April 13, 2017 12:28:31 PM

159595

Page 1

Item ID: D212-664-101TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 5/1/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/5/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals: Process Plan: **DAS 21** Date: **APR 13 2017**

Tooling: _____ Date: _____

Run Start ***NR1***QC: **9-89** Date: _____ SPC (Y/N): _____ Date: _____Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D212-664-141	E
--------------	---

100

0.19

100

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

1.06

1- Fill tube with sand & install plugs 212-141 on both ends as per Folio FA113

2- Face both side of tube

3- Turn first taper section on both side as per folio FA113

4- Blend transition lines only with belt sander 60 grit **Do not sand whole tube**

FOLIO REV: AADWG REV: H**DAS 23 9-89**

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Quality Control

Memo

0.00

DAS 23 9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																																												
Date :	Step #:	QTY Effective :	MRB (QSI042) Approval																																																																											
Description Work Order Deviation		Disposition		Completed By																																																																										
				Lead hand / Supervisor Approval Verification																																																																										
				QC / QA Coordinator Approval																																																																										
<table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th colspan="3" style="text-align: left;">Root Cause</th> <th colspan="3" style="text-align: left;">FAULT CATEGORY</th> </tr> </thead> <tbody> <tr> <td style="width:15%;">Environment ☐</td> <td style="width:15%;">No Re-verification ☐</td> <td style="width:15%;">Pressure/Forced ☐</td> <td style="width:15%;">Temperature/Cure ☐</td> <td style="width:15%;">Power Loss/Surge ☐</td> <td style="width:15%;">Positioned Wrong ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> <td colspan="4" rowspan="2" style="text-align: center; vertical-align: top;">OTHER : _____</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </tbody> </table>					Root Cause			FAULT CATEGORY			Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____				Misidentified ☐	Past Due ☐
Root Cause			FAULT CATEGORY																																																																											
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																									
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																									
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																									
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																									
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																									
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																									
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																									
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																									
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																									
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																									
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____																																																																												
Misidentified ☐	Past Due ☐																																																																													

Work Order ID 159595

Thursday, April 13, 2017 12:28:31 PM

159595

Page 2

Item ID: D212-664-101TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 5/1/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/5/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference: SCHEDULED

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

120

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

1- Turn second taper on both side

2- Blend transition lines only with belte sander 60 grit, **Do not sand whole tube**:

FOLIO REV: AADWG REV: H

3- Remove sand and plugs

4- Scribe part # and batch # using vibrating stylus on the cuff as per Dwg D212-664-141

0.00

1.92

1	Ø		DAS 23 9-89
---	---	--	-------------------

130

130

QC

Quality Control

QC2- Inspect parts off machine FAI/FAIB

Memo

+ PERFORM ULTRA SONIC MEASUREMENT

0.00

0.00

1	Ø		DAS 23 9-89
---	---	--	-------------------

17/6/12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
										QC / QA Coordinator Approval															
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____																			

Work Order ID 159595***159595***

Page 3

Thursday, April 13, 2017 12:28:31 PM

Item ID: D212-664-101TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Turning Detail
Start Date: 5/1/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/5/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140 *140* QC Quality Control	QC8- Inspect parts - second check Memo + CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR BENDING	0.00 0.02				1	0		JW DAS 47 9-89
145 *145* Crosstubes Crosstubes	Memo GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.	0.00 0.71				GP DPL	17	06	20
150 *150* HandFXtube Hand Finishing Crosstubes	Memo 1- PRESSURE WASH X-TUBE INSIDE AND OUT 2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE	0.00 0.53				GP DPL	17	07	03

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 159595

Thursday, April 13, 2017 12:28:31 PM

159595

Page 4

Item ID: D212-664-101TRN**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Crosstube Turning Detail**Start Date:** 5/1/2017 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 5/5/2017 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:** SCHEDULED**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.02

Quality Control

DPZ 17-07-04
JW

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

LOCATION : LG014

DPZ 17-07-04

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.10

Quality Control

17/7/5 *JP*

(Signature)

JUL 04 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Picklist Print

Thursday, April 13, 2017 12:28:34 PM

Page 1

Work Order ID: 159595

159595

Parent Item: D212-664-101TRN

D212-664-101TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 5/1/2017

Required Date: 5/5/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 removed Polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6005-128		Manufactured	No			120	Each	70.0000	1	1			

D6005-128

Crosstube Material

Location

Loc Qty

Loc Code

LG003

70

123963

24

123965

4

139414

30

75642

12

DAS
23
9-89

17/6/8

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

DART AEROSPACE LTD	Work Order: 159595
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number: D212-664-141
Inspection Dwg: D212-664-141 Rev: E	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	0.200	✓		Vernier	DAS 47 OK 9.89
	R0.063	+/-0.010	R0.063	✓		RG	
	2.740	+0.005/-0.000	2.738	✓	✓		
	5.097	+/-0.030	5.097	✓		tape	
	2.304	+0.005/-0.000	2.308	✓			
	2.340	+0.005/-0.000	2.344	✓			
	2.398	+0.005/-0.000	2.402	✓			
	2.448	+0.005/-0.000	2.451	✓			
	2.498	+0.005/-0.000	2.501	✓			
	2.549	+0.005/-0.000	2.554	✓			
	2.599	+0.005/-0.000	2.603	✓			
	2.671	+0.005/-0.000	2.674	✓			
	2.701	+0.005/-0.000	2.703	✓		Vernier	
SIDE B	0.200	+/-0.010	0.200	✓			
	R0.063	+/-0.010	R0.063	✓		RG	
	2.740	+0.005/-0.000	2.738		✓	Vernier	
	5.097	+/-0.030	5.097	✓		tape	
	2.304	+0.005/-0.000	2.308	✓			
	2.340	+0.005/-0.000	2.343	✓			
	2.398	+0.005/-0.000	2.402	✓			
	2.448	+0.005/-0.000	2.451	✓			
	2.498	+0.005/-0.000	2.500	✓			
	2.549	+0.005/-0.000	2.554	✓			
	2.599	+0.005/-0.000	2.603	✓			
	2.671	+0.005/-0.000	2.674	✓			
	2.701	+0.005/-0.000	2.703	✓			
	126.514	+/-0.020	126.514	✓		tape	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabelled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

DART AEROSPACE LTD	Work Order: 159595
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number: D212-664-141
Inspection Dwg: D212-664-141 Rev: E	Page 2 of 2

WALL THICKNESS MEASUREMENT

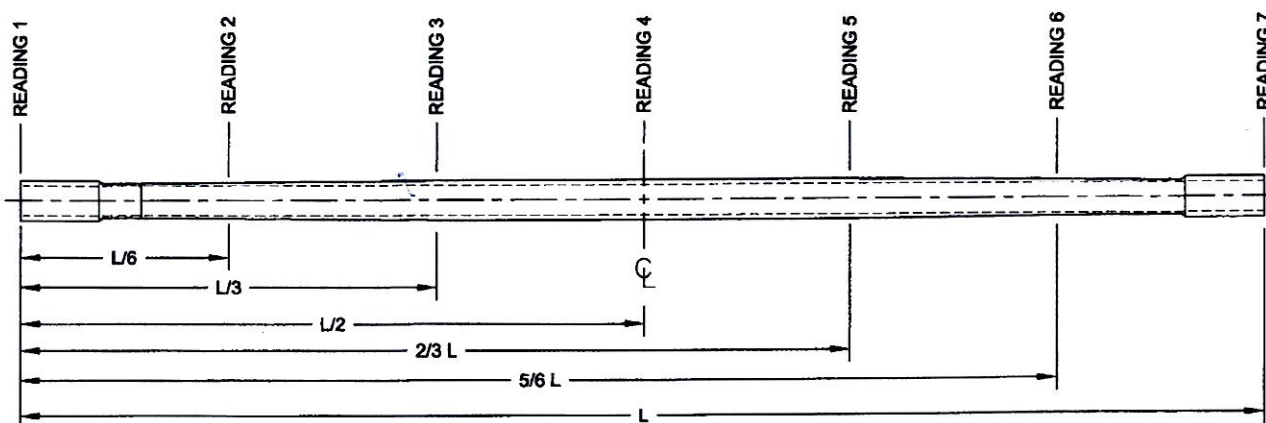

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	377	398	398	381	0.021	0.048"
READING 2 L= 21.09	228	251	261	239	0.033	
READING 3 L= 42.17	352	374	373	351	0.022	
READING 4 L= 63.26	385	400	397	379	0.021	
READING 5 L= 84.35	356	368	368	357	0.012	
READING 6 L= 105.44	239	239	247	249	0.018	
READING 7 L= 126.53	384	389	393	387	0.009	

Calibration Result

Actual Block Thickness: ~~100~~ - 400

Sitescan 250 Measured Thickness: ~~100~~ - 400

DAS
23
9-89

Measured by: _____

Date: 17/6/12

DAS
47
9-89

Audited by: _____

Date: 17.06.19

Preliminary Approval: _____

Date: _____

Rev	Date	Change	Revised by	Approved
C	07.05.28	Dwg Rev updated (P/O D412-664-101)	KJ/JLM	
D	10.02.02	Dimension 126.514 was 126.51	KJ	
E	12.06.04	Wall thickness form added	KJ	
F	14.06.05	Dwg Rev updated	KJ	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 128.514±0.020
- 2) FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT

- FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT

***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.

- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141/-141B/-141F = 33.6 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- 10) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 8% (BASED ON O.D.) ON REMAINING TUBE.
- 12) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- 13) TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 14) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 15955

RELEASED
2014-05-26

E	ADD -141F, D5017-1 WAS D2893-1 (-141B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3), INCORP. DEO D-1/-2/-3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST: REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 8388, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. E
D212-664-141 SHEET 1 OF 5
TITLE SCALE
XTUBE ASSY (205/212/412 HI FWD) NTS

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL. NO PART OF THIS DOCUMENT IS TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, INCLUDING PHOTOCOPYING, RECORDING, OR BY ANY INFORMATION STORAGE AND RETRIEVAL SYSTEM, WITHOUT PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

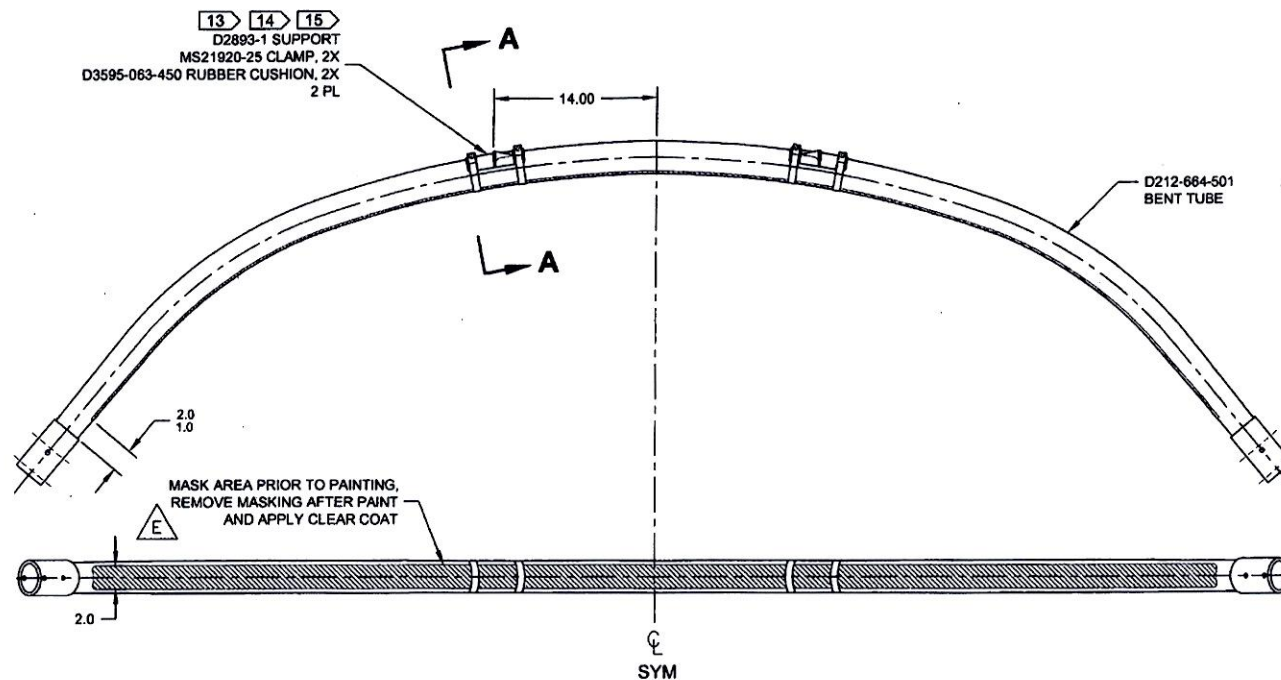

**D212-664-141/-141F
ASSEMBLY DETAIL**

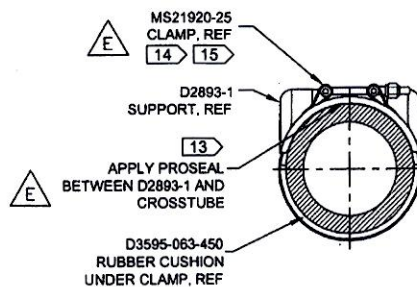

SECTION A-A
SCALE 4X

RELEASED
2014-05-26
AND

DESIGN	Q	DART AEROSPACE LTD	
DRAWN	Q	HAWKESBURY, ONTARIO, CANADA	
CHECKED	SW	DRAWING NO.	REV. E
MFG. APPR.	SW	D212-664-141	SHEET 2 OF 5
APPROVED	SW	TITLE	SCALE
DE APPR.	SW	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2005 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

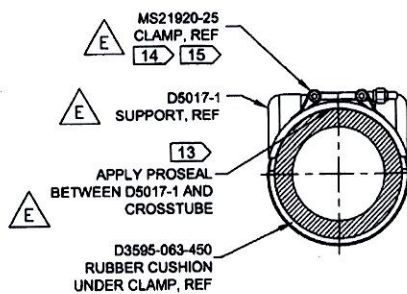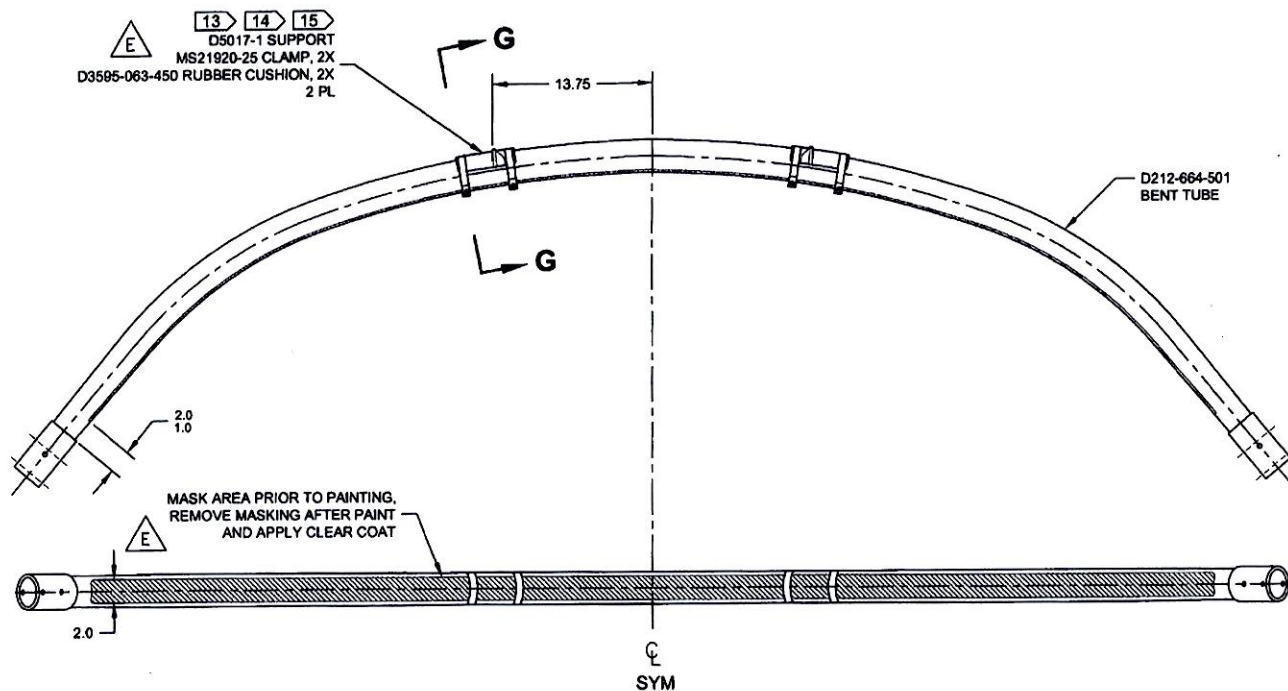

D212-664-141B
ASSEMBLY DETAIL

RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

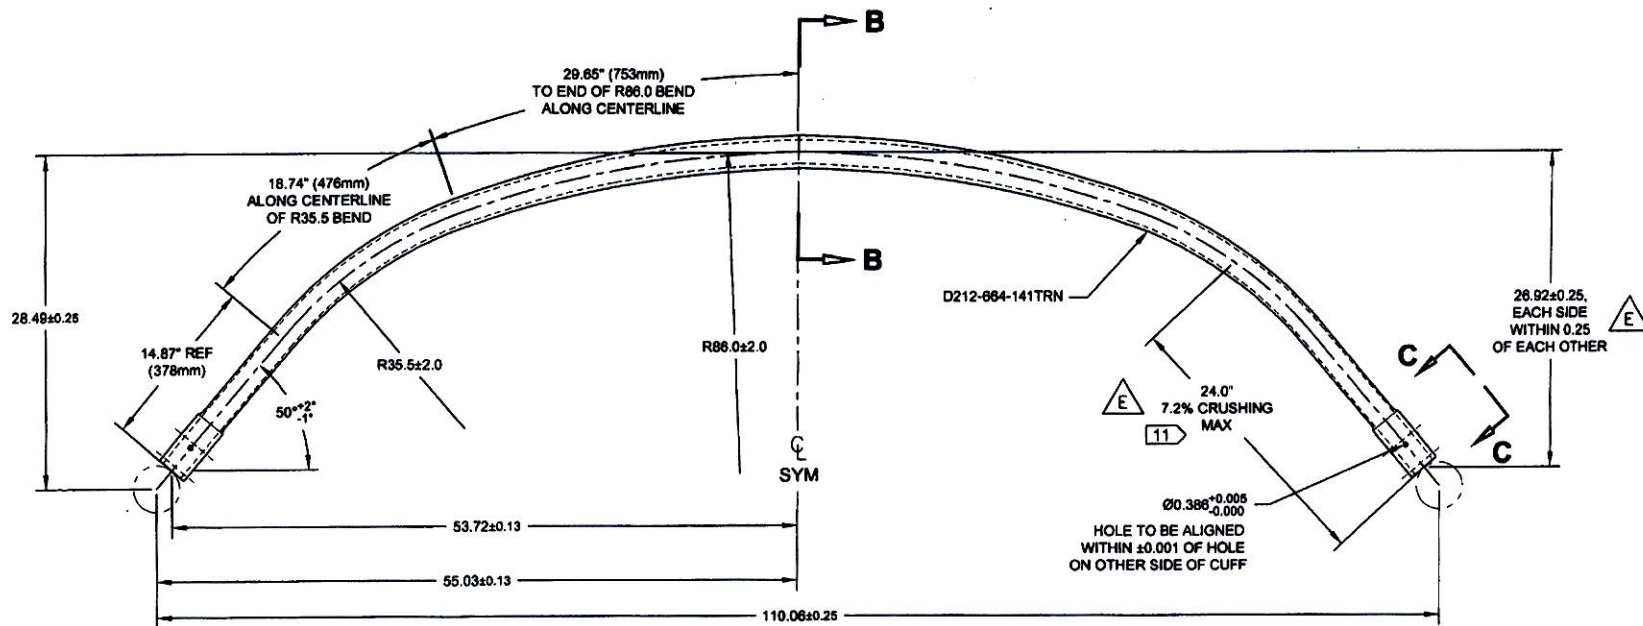

D212-664-501
BENDING AND DRILLING DETAIL 11

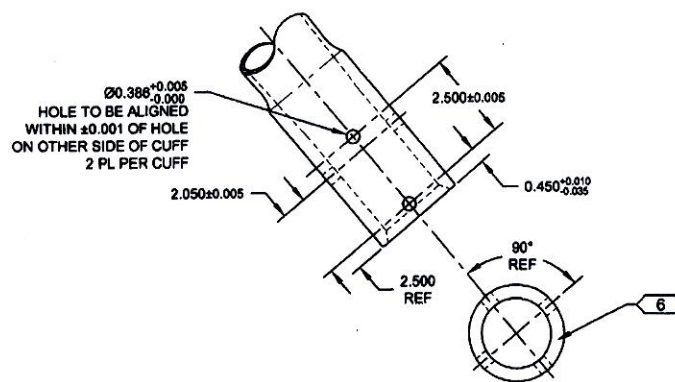

VIEW C-C: CUFF DETAIL
SCALE 3X

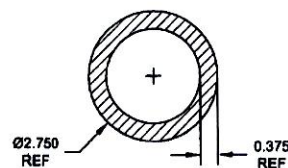

SECTION B-B
SCALE 4X

RELEASED
2014-05-26

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. E
MFG. APPR.	90	D212-664-141	SHEET 4 OF 5
APPROVED	90	TITLE	SCALE
DE APPR.	90	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

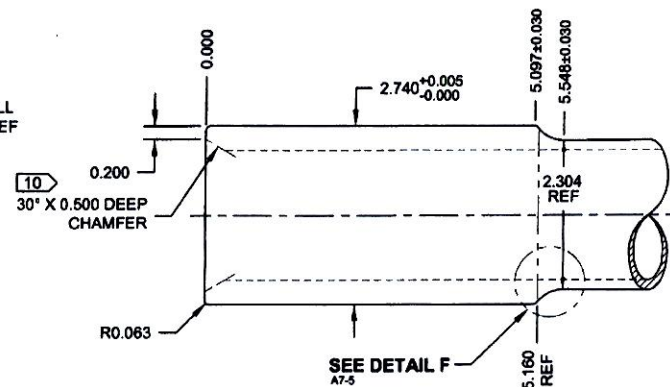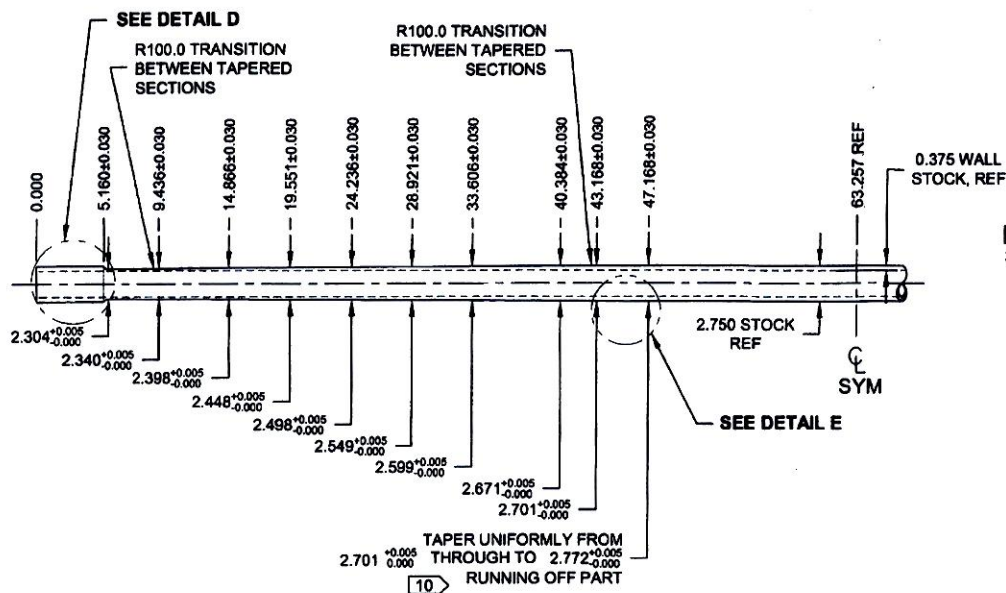


DETAIL D:
CROSSTUBE CUFF
SCALE 5X

D212-664-141TRN
TURNING DETAIL

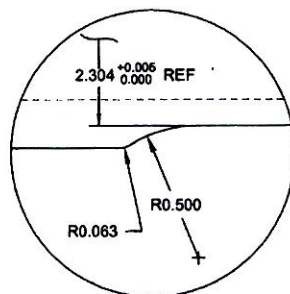

DETAIL F:
CUFF TRANSITION
SCALE 10X

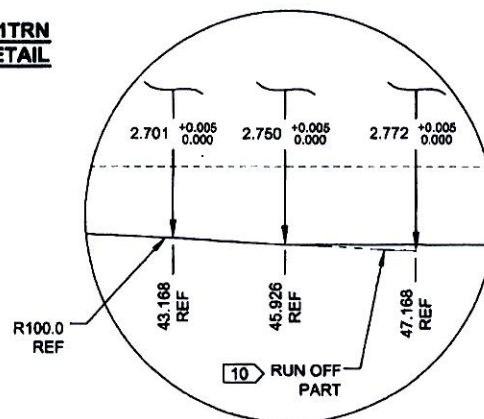

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DLW	DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 5 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2006 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD.			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					